

Substandard case started 6/11/2024

Structures deemed substandard based on the following findings:

- Structures do not meet the minimum requirements and standards as set forth in the International Property Maintenance Code.
- Exterior structures are not in good repair, are not structurally sound, and do not prevent the elements or rodents from entering the structure.
- Interior of the structures are not in good repair, is not structurally sound, and is not in a sanitary condition.
- Structures are unfit for human occupancy and found to be dangerous to the life, health, and safety of the public.

City Recommendation: Demolition of residential and accessory structures (Building Survey attached)

Property located in a residential area.

According to NCAD, no recorded deed on file.

## Case, Abatement, and Citation History

Total number of Code complaints: 0

Total number of cases: 10

Owner Compliance: 1

City Abatements: 4

Citations issued: 0



Date	Case Type	Violation(s)	Status
08/26/2021	PMC Standards		CLOSED
09/02/2021	Care of Premises	Section 22-6 LITTER AND	CLOSED
		SOLID WASTE	
10/11/2022	Unsecured	Section 13-3008 DUTY TO	COMPLIANT
	Vacant Building	SECURE VACANT	
		BUILDING	
10/11/2022	Vacant Building	Section 22-6 LITTER AND	CLOSED
		SOLID WASTE	
02/21/2023	Care of Premises	Section 22-6 LITTER AND	CLOSED
		SOLID WASTE	
02/21/2023	PMC Standards	302.7 Accessory Structures	OWNER
		505.1 Water System/General	COMPLIANCE
		604.1 Electrical Facilities	
		Required	19072 200 1900 1900
02/06/2024	Substandard	108.1.3 Structure Unfit for	CLOSED
	Structure	Human Occupancy	
03/20/2024	Vacant Building	Section 23-70 TALL WEEDS,	IN PROGRESS
		BRUSH, AND DISEASED	
		TREES PROHIBITED ON	
		LOTS & Section 22-6	
		LITTER AND SOLID	
		WASTE	2222222
03/20/2024	Unsecured	Section 13-3008 DUTY TO	IN PROGRESS
	Vacant Building	SECURE VACANT	
	~	BUILDING	DI DD O CDECC
06/11/2024	Substandard	108.1.3 Structure Unfit for	IN PROGRESS
	Structure	Human Occupancy	

# Abatement history for 1258 GOLLA DR.

	<u>Date</u>	Cost/Admin Fee	Case Type
1.	02/16/2024	\$567.78/\$412.00	Mowed/Removed litter
2.	06/28/2024	\$1,485.00/\$412.00	Mowed/Removed litter
3.	06/28/2024	\$1,000.00/\$412.00	Board Up
4.	10/30/2024	\$497.49/\$125.00	Mowed/Removed litter

Total: \$4,911.27



# CCPD calls to property:

Nature of Call	1258 Golla Dr.
Attempt to Contact Welfare Concern	1
Burglary in Progress	1
EMS Request/Medical Emergency Unconscious Patient Specify	1
Forensic Services Request Natural Death	1
Law Enforcement Investigation Field Event	17
Physical Attack/Attempted Bodily Injury In Progress	1
Shots Fired/Deadly Conduct Shots/Suspect Seen	2
Assault in Progress	3
Burglary not Progress	1
Disturbance in Progress	7
Overdose drug Overdose	1
Physical Altercation In Progress	1
Disturbance just Occurred	1
Suspicious or Unusual Suspicious Activity Specify	2
Wanted Person or Property Field Event	2
Alarm le Alarm	1
Forensic Services Request Crimes Against Property	1
Parking Violation Abandoned Vehicle	1
Pursue Suspect Foot Pursuit	1
Suspicious or Unusual Suspicious Person or Persons	1
Attempted Suicide Explain Type	1
Crash Hit and Run	1
Quality of Life Field vent	7
Disturbance injuries Involved	1
Suspicious or Unusual Suspicious Vehicle	1
Trespassing Violation In Progress	2
	60

Attempted contact with Property Owner(s)



DATE	NAME	CONTACT DETAILS
6/25/24	JUDY POURNER	SHE IS AN HEIR TO THE PROPERTY (HER
		BIOLOGICAL MOTHER IS AGNES
		NOLAN). SHE STATES NO INTEREST IN
		THE PROPERTY. SHE IS PARTIALLY
		BLIND, ON A FIXED INCOME, AND LIVES
		OUT OF TOWN. SHE STATED BOTH OF
		HER BROTHERS ARE DECEASED AND
		ONE HAD CHILDREN. SHE GAVE ME
		NAMES BUT HAD NOT ADDRESS
		INFORMATION AND SHE DID NOT SPEAK
		TO THEM.

10/20/	2024					
Code C	ompliance Supervisor: Roland Mald	lonado				
Case#\	Case# V234656-061124					
Propert	ty Owner: Anges Nolan					
Addres	s (⊠Residential ☐Commercial): 1	1258 Golla Dr.				
Staff Re	ecommendation(s): Demolition					
□Resid	dential Structure only	⊠ Residential and Accessory Structure				
□Com	mercial Structure only	☐ Commercial and Accessory Structure	2			
due to		1)(c) of the Corpus Christi Property Maintion of the structure(s), a hazard to the led.				
	· ·	<b>olish</b> the structure(s) within thirty (30) den the City be authorized to demolish.	ays. If demolition is			
Notices						
1. 2. 3. 4.	Letters of substandard conditions Final notice sent by certified mail. Certified letter of hearing sent by Notice of hearing published in new	certified mail				
Additio	onal					
1. 2. 3. 4. 5.	Structure Entered by: ☐ Search W Taxes due: ☐ Current ☐ Pa	If deceased verification by: ⊠Obituary arrant □Consent Given by: st due -Amount owed: \$15,655.34 active-Last active date: 7/27/2020	□Death Certificate ⊠Unsecure			
6	Lawsuits: ⊠Yes □No					

 $\square$  No

7. Code Enforcement Maintaining Property: ⊠Yes

## **COMPLAINT**

Monday, October 28, 2024

Building Standards Board City of Corpus Christi 2406 Leopard St. Corpus Christi, Texas 78408

RE: 1258 Golla Dr.

Case # V234656-061124

**OWNER: Agnes Leona Nolan** 

Code Compliance Supervisor Roland Maldonado

#### Dear Board Members:

Pursuant to Article II and in accordance with Section 13-22(B), of the Corpus Christi Property Maintenance Code, this Department has initiated and prepared the above listed case for your review and consideration. On **June 7**, **2024**, the code official determined that there were reasonable grounds to believe there was a violation(s) of the Corpus Christi Property Maintenance Code or any rule or regulation concerning the health, safety, or general welfare adopted by the city as it relates to structures or premises and gave notice of such alleged violation to the owner of the property. Thirty days have elapsed since the notice of violation(s) was provided and such violation(s) have not been cured.

Staff recommends a hearing be set for not less than ten (10) days or more than forty-five (45) days from the date of this complaint. At this hearing staff recommendation for the above listed property will be repair/demolition.

If you have any questions concerning the above, please call (361) 826-3046.

Roland Maldonado

Supervisor

Development Services Code Compliance Division

cc: Carlos Martinez, Monica Pareso, Catherine Giffin, John Solberg, Merced Pena, William Ewing, Chic Henderson


CASE TIMELINE FOR 1258 GOLLA DR.					
Activity	Date	Legal Requirement	Legal Reference		
Code Enforcement Notified of	6/7/2024				
Potential Violation	0///2024	n/a	n/a		
Initial Inspection Completed		When building, structure or premise	Corpus Christi Property		
	6/7/2024	thought to be substandard	Maintenance Code 104.2		
Notice of Violation Mailed to Last		When there are reasonable grounds to	City Ordinance		
Known Addresses	6/18/2024	believe there is a violation	Sec. 13-22(A) & (D)(2)		
Notice of Violation Posted in		When owner is unknown, whereabouts	City Ordinance Sec.13-		
Newspaper	7/19/2024 &	unknown, or where service of notice has	22(A) & (D)(3)		
	7/22/2024	failed (Published twice w/in a 10 day period)			
Deadline to comply with Newspaper		When 30 days have elapsed from the date	City Ordinance		
Notice of Violation	8/19/2024	of first publication	Sec. 13-22(B)		
Notice Received		Returned mail rec'd-Return to sender,	n/a		
	6/26/2024	vacant, unable to forward			
Returned Notice of Violation Posted at	9/23/24-9/27/24 &	When notice is returned showing	City Ordinance		
Front Door of Property	9/30/24-10/4/24	unclaimed or not delivered	Sec. 13-22(A) & (D)(4)		
Deadline to comply with Mailed Notice	7/10/2022	30 days from receipt of the notice	City Ordinance		
of Violation	7/19/2023		Sec. 13-22(A)(5)		
Re-inspection		Not less thans 30 days from receipt of the	City Ordinance		
	7/24/2024	notice or when 30 days have elapsed from	Sec. 13-22(B)		
Complete Class 1 11 PCP		date of first publication			
Complaint filed with BSB		When owner refused to comply; when not cured within 30 days from receipt of	City Ordinance Sec. 13-22(B)(2)		
	10/28/2024	notice or any further agreed time; or	Sec. 15-22(b)(2)		
	10/28/2024	when 30 days have elapsed from date of			
		first publication			
Notice of Hearing Mailed to Last		At least 10 days prior to hearing	City Ordinance		
Known Address	10/29/2024	, .	Sec. 13-22(C) & (D)(2)		
	10, 23, 232		, , , , , ,		
Notice of Hearing Posted in Newspaper		At least 10 days prior to hearing when	City Ordinance Sec.13-		
	10/28/2024 &	owner is unknown, whereabouts	22(C) & (D)(3)		
	10/29/2024	unknown, or where service of notice has			
	, ,	failed (Published twice w/in a 10 day period)			
Notice of Hearing Filed with County		At least 10 days prior to hearing	City Ordinance Sec. 13-		
Clerk	10/30/2024		22(C) & Tx Local Gov't		
			Code 214.001€		
Returned Notice of Hearing Posted at Front Door of Property	11/11/24-11/15/24 &	When notice is returned showing unclaimed or not delivered	City Ordinance		
BSB Agenda Posted	11/18/24-11/20/24	72 hours (3 days) before scheduled time	Sec. 13-22(C) & (D)(4) Texas Govt. Code		
ass rigerial rosted	11/15/2024	of hearing	551.043(a)		
BSB Hearing	11/21/2024	Not less than 10 days nor more than 45	City Ordinance		
	11/21/2024	days after Complaint filed	Sec. 13-22 (C)		



# 1258 GOLLA DR

Aerial View




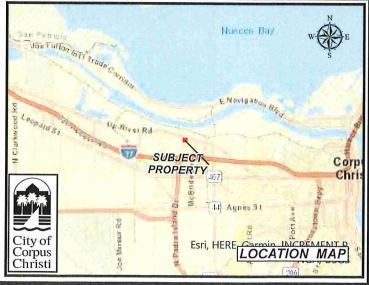







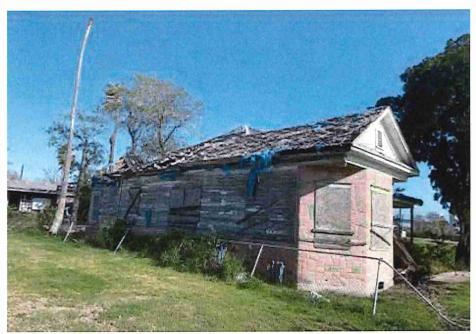

















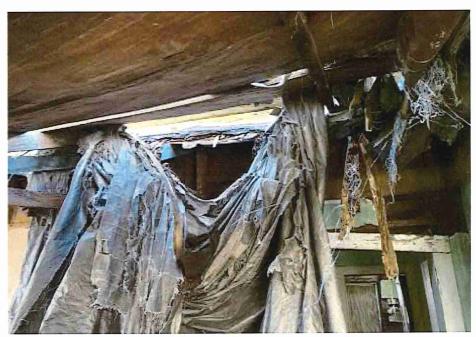




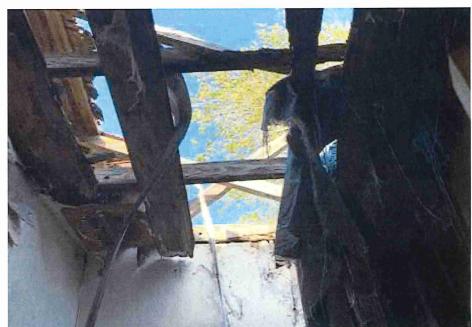





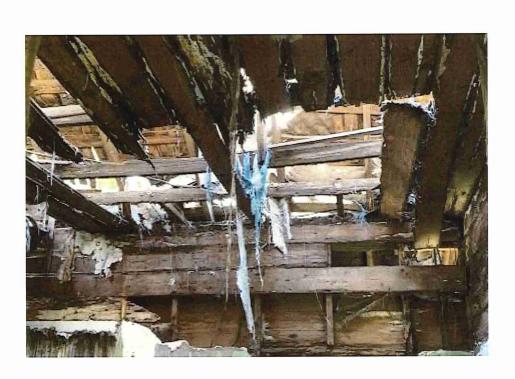

# City of Corpus Christi – BUILDING SURVEY

Account Number: 4740000	30320				
nspection Date: 6/7/2024					
Zoning Use: RS-6					
Revised Date: 06/17/2024					
Officer: Mike Shelton					
Property Address: 1258 G	OLLA DR				
_egal Description: MANCH	HESTER PLACE BL	K 3 LOT 32			
Owner: NOLAN AGNES					
Mail to: 1258 GOLLA DR					
	CUDISTI TY 78407	7_1319			
City, State, Zip: CORPUS	CHRISTI, 1X / 640/	-1312			
XDwelling XWood Frame XVacant Placard Posted on: <u>6/7/202</u>	Commercial Masonry Occupied	XAccessory Fire Damage XOpen	Sq. l # of XPlac	Units XInside Inspe	ctior
Plumbing, Electrical, Me Permits Required:				nces are applicable: Building,	
Smoke Alarms:					
	Inoperative	Improperly Loc	cated	Additional Alarms Required	
OUTSIDE WALL: (304.1, 304.2 304.					
Type: Charred Wood	4 & 304.6)	ROOF: (304.1 & 304.7) Type: Charred Wood		FOUNDATION: (304.1, 304.4 & 304.5) Type:Inadequate Support	
Charred Wood XRotten Wood	X	(304.1 & 304.7) Type: Charred Wood Rotten Eaves		(304.1, 304.4 & 304.5) Type:Inadequate SupportRotten Wood	
Charred Wood  X Rotten Wood  X Rotten Corner Boa	X	(304.1 & 304.7) Type: Charred Wood		(304.1, 304.4 & 304.5) Type: Inadequate Support	
Charred Wood XRotten Wood	X ards	(304.1 & 304.7) Type:Charred WoodRotten EavesRotten Rafter Tails		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall	
Charred Wood  X Rotten Wood  X Rotten Corner Boa  X Missing Boards	X ards	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab	
Charred Wood  X Rotten Wood  X Rotten Corner Boa  X Missing Boards  X Badly in Need of F	X ards	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked	
Charred Wood X Rotten Wood X Rotten Corner Boa X Missing Boards X Badly in Need of F X Siding Broken / Mi Holes Cracks	X ards	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting	
Charred Wood X Rotten Wood X Rotten Wood X Rotten Corner Boa X Missing Boards X Badly in Need of F X Siding Broken / Mi Holes Cracks Buckled	X ards	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover	
Charred Wood X Rotten Wood X Rotten Wood X Rotten Corner Boa X Missing Boards X Badly in Need of F X Siding Broken / Mi Holes Cracks Buckled Leans	X ards	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled Collapsed		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills	
Charred Wood X Rotten Wood X Rotten Wood X Rotten Corner Boa X Missing Boards X Badly in Need of F X Siding Broken / Mi Holes Cracks Buckled Leans Missing Brick	X ards	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled Collapsed Worn		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills Rotten Sills	
Charred Wood X Rotten Wood X Rotten Wood X Rotten Corner Boa X Missing Boards X Badly in Need of F X Siding Broken / Mi Holes Cracks Buckled Leans Missing Brick Loose Brick	x ards X Paint ssing X	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled Collapsed Worn Torn		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills Rotten Sills Damaged Floor Joist	
Charred Wood X Rotten Wood X Rotten Wood X Rotten Corner Boa X Missing Boards X Badly in Need of F X Siding Broken / Mi Holes Cracks Buckled Leans Missing Brick	x ards X Paint ssing X	(304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled Collapsed Worn		(304.1, 304.4 & 304.5) Type: Inadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills Rotten Sills	

X X X X X X	WINDOWS: (304.1, 304.2 304.13, 304.13.1, 304.13.2, 304.14 & 304.17)  Charred Wood Broken Glass Missing Screens Torn Screens Torn Screens Missing / Broken Sash Do Not Open Rotten Sills Rotten / Broken Frames Other:	PORCHES: (304.1, 304.2, 304 304.12, 305.4, 305.5 & 307.1)  Charred Wood Missing / Broken Boards Loose Rotten Wood Inadequate Support Support Post Missing Support Post Loose Faulty Weather Protection Other:	.10, DOORS: (304.1, 304.2, 304.13, 304.14, 304.15, 304.16, 304.18, 305.6 & 702.1) Charred Wood  XMissing  XDamaged  XPoor FitDamaged / Missing Screen(s)Off Hinges  XBlocked Exit  XRottenOther:
X	STEPS: (304.1, 304.2 304.10, 304.12, 305.4 & 305.5)  Charred Wood Rotten Wood Missing Boards Inadequate Support Missing Handrails Faulty Weather Protection Other:	(403.2, 502.1, & 505.3) Missing	ilow Plate ver Head
<u></u>	PLUMBING: WATER CLOSET (404.4.3, 502.1, 502.2, 502.3, 502.4 504.1, 504.2, 504.3, 505.1.1, 506.1  Missing  No Anti-Siphon Ballcock  Stopped Up  Poorly Anchored  Seeps Around Bowl  Water Supply Line Leaks  Flush Ell Leaks  Runs Constantly  Tank Broken / Cracked  Bowl Broken / Cracked  Disconnected  Missing Flush Handle  Missing Flapper  Urinal; No Back-Flow Preventive  No Elongated Bowl / Open-end Sea  Other:	& 506.2)  Gas Electric Missing X Disconnected Temperature Temperature Drain Line Mi Not Approved Not Extended Elbowed Dow Vent Missing No Double W Nonconformir Inadequate C Thermostat M Mo Gas Cut C Missing Fireb Gas Supply L Gas Fired – L	TER: , 603.2, 603.3, 603.4 603.5 & 603.6)  Pressure Release Valve Missing Pressure Release Valve Broken ssing I Pipe I Outside //n / Loose all Pipe / Attic ng Vent ombustion Air lissing / Damaged Off ox Door ine Not Approved Pipe located in Bathroom located in Bedroom

	<b>LAVATORY:</b> (404.4.3, 502.1, 502.2, 502.3 502.4, 504.1, 504.2, 504.3, 505.1.1,		AS SYSTEM: (602.1, 602.2, 602.3, 602.5 3.1, 603.2, 603.3, 603.4, 603.5 & 603.6)
	506.1 & 506.2)	0-	December Test Described
	Missing		as Pressure Test Required
	No Anti-Siphon Faucets		as Leak
	Faucets Leak / Broken / Missing		ne Appears to Enter Building Below Grade Level
	"P" Trap Leaks / Missing		as Supply Not Approved Pipe
	Defective Trap		bber Hose to Space Heaters
	Stopped Up		on-Rigid Pipe Run Through Partition Wall
	Water Supply Line Leak	Ot	her:
	Loose from Wall		
	Nonconforming Waste Line		
<u>X</u>	Disconnected		
	Other:		
	KITCHEN SINK: (305.1, 305.3, 502.1,	PL	LUMBING MISCELLANEOUS:
	505.1.1, 506.1 & 506.2)	·-	04.1, 504.2, 504.3, 505.3, 506.2 & 507.1)
	Defective Trap		oen Clean Out / Water Leak; Yard / Under House
	Faucets Loose / Broken	Ve	ent Stack Missing / Broken
	Faucets Missing	Ve	ent Stack Not Extended Through Roof
	"P" Trap Rubber Hose	Ra	ain Guard Damaged / Missing
	Trap Leaks / Missing	Ex	posed Exterior PVC Pipe
	Stopped Up	P\	/C Water Supply Lines
<u>X</u>	Disconnected	W	asher No "P" Trap / Not Vented / Not Cut Offs
	Damaged Counter Top	Se	ewer Line Stopped Up
	Damaged Back Splash	Se	ewer Running Out on Ground
	Other:	Ot	her:
	ELECTRICAL SERVICE: (604.1, 604.2	IN	SIDE WALLS AND CEILINGS:
	604.3, 604.3.1, 604.3.1.1, 604.3.2, 604.3.2.1	(3	05.1, 305.2, 305.3 & 404.3)
	605.1, 605.2 & 605.3)		
	Service Panel Burned	Cł	narred Wood
	Service Missing	XPa	aint Deteriorated
	Service Appears Below Code	XCr	acks
	Two-Wire Service	XHo	ples
	Inadequate	Tc	orn Wallpaper
<u>X</u>	Defective	Da	amaged Paneling
<u>X</u>	Disconnected	XSh	neetrock Broken / Missing / Holes, 506.1 & 506.2
	Service Not Grounded	Sh	neetrock Mildewed / Buckled
<u>X</u>	Missing Breakers / Fuses	XC	eiling Damaged / Missing
	Missing Interior / Exterior Panel Cover	XW	ater Damaged / Smoke Damaged
<u>X</u>	Exposed Wiring	Im	pervious Material Around Tub
	Nonconforming Wiring in Panel	Er	nclosure Damaged / Missing
	Drops Too Low	W	alls Around Tub Not Water Resistant
	Other:	Ina	adequate Ceiling Height
		Ot	her:

	SYSTEM:	INTERIOR FLOORS:
	(604.3.2. 604.3.2.1, 605.1, 605.2 & 605.3)	(305.1, 305.2, 305.3 & 305.4)
	Burned Wiring / Plugs / Switches	Charred Wood
	Burned Fixtures	X Rotten Wood
	Less Than 1 Duplex Recept. /20 liner ft-	Missing Boards
	Bedroom/Living Rm/Dining Rm/Den/Kitchen	Holes
	No Small Appliance Circuits Over Kitchen	Cracks
	Counter Space with GFCI	X Not Level
	Only One Small Appliance Circuit Over Kitchen	Buckled
	Counter Space with NO GFCI	Torn
	Kitchen Appliance Circuits – No GFCI	XDamaged
	Plugs Missing / Loose / Broken	Other:
	Switches Missing / Loose / Broken	
X	Fixtures Missing / Loose / Broken	
	Missing Switch Cover / Plug Covers	
	Extension Cords in Place of Permanent Wiring	
	Bathroom Circuit NO GFCI	
	Conduit Broken / Loose / Missing	
	No Separate Circuit For	
	No Disconnect for Air Conditioner	
~	Exterior Lights Missing; Front / Back / Side	
<u>X</u> X	Porch Lights Broken / Missing / Loose	
	Other:	
	MECHANICAL:	ACCESSORY SURVEY:
	(403.1, 403.2, 603.1 & 603.6)	(302.7, 304.1, 304.2, 304.4, 304.5, 304.6 & 305.2)
	Vented Wall Heater Damaged / Missing	TYPE:SHED
	Floor Furnace Damaged / Missing	Roof Type: SHINGLE
	Nonconforming Gas Line to Space Heater	XRotten
<del></del>	Wall Heater with No Vent in Bathroom	XLoose
		ΛΕ0036
		Torn
	Thermostat Damaged / Missing	•
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of	Torn
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' ofTub / Shower / Water Closet	Torn XHoles
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing	Torn XHoles
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom	Torn XHolesMissing
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable	Torn  XHolesMissing Walls Type: WOOD FRAAME
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building	Torn  XHolesMissing Walls Type: WOOD FRAAME  XRotten
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building Fire Damage	Torn  XHolesMissing Walls Type: WOOD FRAAME  XRotten  XLeaning
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building	Torn XHolesMissing Walls Type: WOOD FRAAME XRotten XLeaning XBuckled
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building Fire Damage Other:	Torn XHolesMissing Walls Type: WOOD FRAAME XRotten XLeaning XBuckledMissing
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building Fire Damage Other: UNSANITARY CONDITIONS:	Torn XHolesMissing Walls Type: WOOD FRAAME XRotten XLeaning XBuckledMissing
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building Fire Damage Other:  UNSANITARY CONDITIONS: (308.3, 309.1, 504.1 & 505.1.2)	Torn XHolesMissing Walls Type: WOOD FRAAME XRotten XLeaning XBuckledMissingOther:
	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building Fire Damage Other:  UNSANITARY CONDITIONS: (308.3, 309.1, 504.1 & 505.1.2) No Hot and Cold Water Supply	Torn  XHolesMissing Walls Type: WOOD FRAAME  XRotten  XLeaning  XBuckledMissingOther:Foundation Type:
X X	Thermostat Damaged / Missing Gas-Fired Heating Appliance within 2' of Tub / Shower / Water Closet Condensing Unit Damaged / Missing No Vent Fan or Window in Bathroom Vent Fan Missing / Not Operable Heat with No Vent in Commercial Building Fire Damage Other:  UNSANITARY CONDITIONS: (308.3, 309.1, 504.1 & 505.1.2)	Torn XHolesMissing Walls Type: WOOD FRAAME XRotten XLeaning XBuckledMissingOther:Foundation Type:Sunken



## CODE ENFORCEMENT DIVISION

#### ACCESSORY BUILDING SURVEY



Address:	1258 GOLLA DR
Legal Description:	MANCHESTER PLACE BLK 3 LOT 32
Tax Account No:	4740-0003-0320
Property Owner:	NOLAN AGNES
Mailing Address:	1258 GOLLA DR

Inspection Date: 2/1/2024
Zoning District: RS-6
Compliance Officer: Mike Shelton

Placard Date:

City, State, Zip:

2/1/2024

Case No:

V224151-020624

CORPUS CHRISTI, TX 78407-1312

Corrections must be made to the item(s) checked below to comply with the Corpus Christi Property Maintenance Code and/or ordinances of the City of Corpus Christi. The following city ordinances are applicable: Building, Plumbing, Electrical, Mechanical, Fire, Health and Zoning.

•							
Permits required:	Building	Plumbing	Electrical	Mechanical	Fire	Othe	r:
Accessory Structure 7 (302.7, 304.1, 304.2, 304		304.7, 305.1 & 305.2	Wood Frame				
Roof Type: SHINGLE X Rotten							٠
Loose							
Torn							
XHoles						1 to the	11:
Missing			Desci	ription	Max	Unit	Uni

X Rotten
Loose
Torn
X Holes
Missing
Other:

Wall Type: WOOD FRAME
X Rotten
X Leaning
X Buckled
X Missing
Other:

Foundation Type: SLAB
Sunken
Cracked

Rotten
Other:

Description	Max	Unit A	Unit B	Unit C	Unit D
Roofing Frame	16				
Roof Cover	17				
Wall Framing	18				
Siding	15				
Foundation	24				
Doors/Windows	10	_			
Total %	100				

#### VIOLATION(S): 1258 GOLLA DR.

- 108.1.1 Unsafe structures. An unsafe structure is one that is found to be dangerous to the life, health, property or safety of the public or the occupants of the structure by not providing minimum safeguards to protect or warn occupants in the event of fire, or because such structure contains unsafe equipment or is so damaged, decayed, dilapidated, structurally unsafe or of such faulty construction or unstable foundation, that partial or complete collapse is possible.
- 108.1.3 Structure unfit for human occupancy. A structure is unfit for human occupancy whenever the code official finds that such structure is unsafe, unlawful or, because of the degree to which the structure is in disrepair or lacks maintenance, is insanitary, vermin or rat infested, contains filth and contamination, or lacks ventilation, illumination, sanitary or heating facilities or other essential equipment required by this code, or because the location of the structure constitutes a hazard to the occupants of the structure or to the public.
- 108.1.5 Dangerous structure or premises. For the purpose of this code, any structure or premises that has any or all of the conditions or defects described below, but which is not limited to those described below, shall be considered dangerous and may be deemed substandard:
- 1. Any door, aisle, passageway, stairway, exit or other means of egress that does not conform to the approved building or fire code of this City as related to the requirements for existing buildings.
- 2. The walking surface of any aisle, passageway, stairway, exit or other means of egress is so warped, worn loose, torn or otherwise unsafe as to not provide safe and adequate means of egress.
- 3. Any portion of a building, structure or appurtenance that has been damaged by fire, earthquake, wind, flood, deterioration, neglect, abandonment, vandalism or by any other cause to such an extent that it is likely to partially or completely collapse, or to become detached or dislodged, or which cannot be expected to withstand winds of hurricane force.
- 4. Any portion of a building, or any member, appurtenance or ornamentation on the exterior thereof that is not of sufficient strength or stability, or is not so anchored, attached or fastened in place so as to be capable of resisting natural or artificial loads of one and one-half the original designed value.
- 5. The building or structure, or part of the building or structure, because of dilapidation, deterioration, decay, faulty construction, the removal or movement of some portion of the ground necessary for the support, or for any other reason, is likely to partially or completely collapse, or some portion of the foundation or underpinning of the building or structure is likely to fail or give way.
- 6. The building or structure, or any portion thereof, is clearly unsafe for its use and occupancy.
- 7. The building or structure is neglected, damaged, dilapidated, unsecured or abandoned so as to become an attractive nuisance to children who might play in the building or structure to their danger, becomes a harbor for vagrants, criminals or immoral persons, or enables persons to resort to the building or structure for committing a nuisance or an unlawful act.
- 8. Any building or structure has been constructed, exists or is maintained in violation of any specific requirement or prohibition applicable to such building or structure provided by the approved building or fire code of the jurisdiction, or of any law or ordinance to such an extent as to present either a substantial risk of fire, building collapse or any other threat to life and safety.
- 9. A building or structure, used or intended to be used for dwelling purposes, because of inadequate maintenance, dilapidation, decay, damage, faulty construction or arrangement, inadequate light. Ventilation, electrical, mechanical, or plumbing system, or otherwise, is determined by the code official to be unsanitary, unfit for human habitation or in such a condition that is likely to cause sickness or disease, including all conditions conducive to the harboring of rats or mice or other disease-carrying animals or insects reasonably calculated to spread disease.
- 10. Any building or structure, because of a lack of sufficient or proper fire- resistance-rated construction, fire protection systems, electrical system, fuel connections, mechanical system, plumbing system or other cause, is determined by the code official to be a threat to life or health.
- 11. All buildings or structures which have pit privies where the same are not permitted by law or which are not connected to the city sewer when required by law or where inadequate and unsanitary pit privies or septic tanks exist.
- 12. Any portion of a building remains on a site after the demolition or destruction of the building or structure or whenever any building or structure is abandoned so as to constitute such building or portion

thereof as an attractive nuisance or hazard to the public.

302.7 Accessory structures. All accessory structures, including detached garages, shall be maintained structurally sound and in good repair.

- 304.1 General. The exterior of a structure shall be maintained in good repair, structurally sound and sanitary so as not to pose a threat to the public health, safety or welfare.
- 304.10 Stairways, decks, porches and balconies. Every exterior stairway, deck, porch and balcony, and all appurtenances attached thereto, shall be maintained structurally sound, in good repair, with proper anchorage and capable of supporting the imposed loads.
- 304.12 Handrails and guards. Every handrail and guard shall be firmly fastened and capable of supporting normally imposed loads and shall be maintained in good condition.
- 304.13 Window, skylight and door frames. Every window, skylight, door and frame shall be kept in sound condition, good repair and weather tight.
- 304.13.1 Glazing. Glazing materials shall be maintained free from cracks and holes.
- 304.13.2 Openable windows. Every window, other than a fixed window, shall be easily openable and capable of being held in position by window hardware.
- 304.15 Doors. Exterior doors, door assemblies, operator systems if provided, and hardware shall be maintained in good condition. Locks at all entrances to dwelling units and sleeping units shall tightly secure the door. Locks on means of egress doors shall be in accordance with Section 702.3.
- 304.4 Structural members. Structural members shall be maintained free from deterioration, and shall be capable of safely supporting the imposed dead and live loads.
- 304.4 Structural members. Structural members shall be maintained free from deterioration, and shall be capable of safely supporting the imposed dead and live loads.
- 304.5 Foundation. All foundations, piers, or other structural elements shall be maintained plumb and capable of adequate support, free from open cracks and breaks and shall be kept in such condition so as to prevent the entry of rodents and other pests.
- 304.6 Exterior walls. Exterior walls shall be free from holes, breaks, and loose or rotting materials; and maintained weatherproof and properly surface coated where required to prevent deterioration.
- 304.7 Roofs and drainage. The roof and flashing shall be sound, tight and not have defects that admit rain. Roof drainage shall be adequate to prevent dampness or deterioration in the walls or interior portion of the structure. Roof drains, gutters and downspouts shall be maintained in good repair and free from obstructions. Roof water shall not be discharged in a manner that creates a public nuisance.
- 305.1 General. The interior of a structure and equipment therein shall be maintained in good repair, structurally sound and in a sanitary condition. Occupants shall keep that part of the structure which they occupy or control in a clean and sanitary condition. Every owner of a structure containing a rooming house, housekeeping units, a hotel, a dormitory, two or more dwelling units or two or more nonresidential occupancies, shall maintain, in a clean and sanitary condition, the shared or public areas of the structure and exterior property.
- 305.2 Structural members. Structural members shall be maintained structurally sound, and be capable of supporting the imposed loads.
- 305.3 Interior surfaces. Interior surfaces, including windows and doors, shall be maintained in good, clean

and sanitary condition. Peeling, chipping, flaking or abraded paint shall be repaired, removed or covered. Cracked or loose plaster, decayed wood and other defective surface conditions shall be corrected.

305.6 Interior doors. Every interior door shall fit reasonably well within its frame and shall be capable of being opened and closed by being properly and securely attached to jambs, headers or tracks as intended by the manufacturer of the attachment hardware.

308.3 Disposal of garbage. Every occupant of a structure shall dispose of garbage in a clean and sanitary manner by placing such garbage in an approved garbage disposal facility or approved garbage containers.

309.1 Infestation. All structures shall be kept free from insect and rodent infestation. All structures in which insects or rodents are found shall be promptly exterminated by approved processes that will not be injurious to human health. After pest elimination, proper precautions shall be taken to prevent reinfestation.

504.1 General. Plumbing fixtures shall be properly installed and maintained in working order, and shall be kept free from obstructions, leaks and defects and be capable of performing the function for which such plumbing fixtures are designed. Plumbing fixtures shall be maintained in a safe, sanitary and functional condition.

604.3 Electrical system hazards. Where it is found that the electrical system in a structure constitutes a hazard to the occupants or the structure by reason of inadequate service, improper fusing, insufficient receptacle and lighting outlets, improper wiring or installation, deterioration or damage, or for similar reasons, to include but not limited to hazards associated with fire exposure, the code official shall require the defects to be corrected to eliminate the hazard.

605.3 Luminaires. Every public hall, interior stairway, toilet room, kitchen, bathroom, laundry room, boiler room and furnace room shall contain not less than one electric luminaire. Pool and spa luminaires over 15 V shall have ground fault circuit interrupter protection.

702.1 General. A safe, continuous and unobstructed path of travel shall be provided from any point in a building or structure to the public way. Means of egress shall comply with the International Fire Code as adopted and amended by the City.



# CASE DOCUMENTATION FOR VIOLATION LETTERS MAILED FOR BSB HEARING [ALL LETTERS ARE MAILED CERTIFIED AND FIRST CLASS]

Case No: B1 Letters, V234656-061124

ADDRESS: 1258 GOLLA DR.

Tax Account No: 4740-0003-0320

Owner(s): AGNES NOLAN

LAST UPDATED ON: Wednesday, November 06, 2024

## LETTERS MAILED from 6/18/2024 TO 7/10/2024

MAILED TO	ASSOCIATION WITH PROPERTY	RETURNED MAIL NOTES
NOLAN AGNES	DECEASED OWNER	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-
CORPUS CHRISTI, TX. 78407-1312		RETURN TO SENDER
		VACANT
		UNABLE TO FORWARD
UNKNOWN HEIRS OF AGNES NOLAN	UNKNOWN HEIRS OF DECEASED OWNER	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		VACANT
		UNABLE TO FORWARD
GARRY L. NOLAN	DECEASED HEIR	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		VACANT
		UNABLE TO FORWARD
UNKNOWN HEIRS OF GARRY L. NOLAN	UNKNOWN HEIRS OF DECEASED HEIR	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		VACANT
,		UNABLE TO FORWARD
JAMES M. NOLAN	DECEASED HEIR	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		VACANT
		UNABLE TO FORWARD
UNKNOWN HEIRS OF JAMES M. NOLAN	UNKNOWN HEIRS OF DECEASED HEIR	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-

CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		VACANT
		UNABLE TO FORWARD
JUDY POURNER	HEIR	
1258 GOLLA DR.	HEIK	B1 Letter Mailed on 6/18/2024
CORPUS CHRISTI, TX. 78407		RETURNED MAIL REC'D 6/26/24-
CONFOS CHRISTI, 1X. 78407		RETURN TO SENDER
		VACANT
ILIDA DOLIDVIED		UNABLE TO FORWARD
JUDY POURNER	HEIR	B1 Letter Mailed on 6/18/2024
157 COUNTY RD 3085		RETURNED GREEN CARD REC'D 6/25/24-
ORANGE GROVE, TX. 78372		SIGNED AND REC'D BY THOMAS I. POURNER
		DATE OF DELIVERY 6/22/24
OTHA U. NOLAN	DECEASED OWNER	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		VACANT
		UNABLE TO FORWARD
UNKNOWN HEIRS OF OTHA U. NOLAN	UNKNOWN HEIRS OF DECEASED OWNER	B1 Letter Mailed on 6/18/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 6/26/24-
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		VACANT
		UNABLE TO FORWARD
PAM NOLAN	HEIR	B1 Letter Mailed on 7/10/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 7/18/24
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		INSUFFICIENT ADDRESS
		UNABLE TO FORWARD
BEN NOLAN	HEIR	B1 Letter Mailed on 7/10/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 7/18/24
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		INSUFFICIENT ADDRESS
		UNABLE TO FORWARD
GARRY NOLAN JR	HEIR	B1 Letter Mailed on 7/10/2024
1258 GOLLA DR.		RETURNED MAIL REC'D 7/18/24
CORPUS CHRISTI, TX. 78407		RETURN TO SENDER
		INSUFFICIENT ADDRESS
		UNABLE TO FORWARD
		ONABLE TO FORWARD