

938 MENDOZA ST. – RESIDENTIAL & ACCESSORY STRUCTURE

Substandard case started 4/15/2023

Structures deemed substandard based on the following findings:

- Structures do not meet the minimum requirements and standards as set forth in the Corpus Christi Property Maintenance Code.
- Exterior of the structures are not in good repair, are not structurally sound, and do not prevent the elements or rodents from entering the structures.
- Interior of the structures are not in good repair, are not structurally sound, and are not in a sanitary condition.
- Structures are unfit for human occupancy and found to be dangerous to the life, health, and safety of the public.

City Recommendation: Demolition of residential & accessory structure (Building Survey attached)

Property located in a residential area.

According to NCAD, the owner took possession of property 9/28/2001.

Case, Abatement, and Citation History

Total number of Code complaints: 1

Total number of cases: 8

Owner Compliance: 2

City Abatements: 6

Citations issued: 1



938 MENDOZA ST. – RESIDENTIAL & ACCESSORY STRUCTURE

Date	Case Type	Violation(s)	Status
06/07/2024	Vacant Building	Tall weeds, litter and solid	In progress
		waste & sidewalks, curbs and	
		gutters	
04/18/2024	Junk Vehicle	Inoperable vehicle on property	Seized by City
04/17/2024	Unsecure Vacant	Unsecure openings	Abated by City
	Building		
04/15/2024	Substandard	Substandard main &	In progress
	Structure	accessory structure	
06/09/2023	Vacant Building	Tall weeds, litter and solid	Abated By City-
	-	waste & sidewalks, curbs and	Expired
		gutters	
12/11/2018	PMC Standards	Openable Windows & Roofs	Expired
		and Drainage	
11/21/2018	Care of Premises	Tall weeds, Dangerous Fence	Expired
09/13/2018	Care of Premises	Litter and solid waste,	Expired
		sidewalks, curbs & gutters	
		clean	

Abatement history for 938 MENDOZA ST.

	<u>Date</u>	Cost/Admin Fee	Case Type
1.	07/25/2024	\$200.19/\$412	Abatement of tall weeds
2.	10/25/2024	\$320/\$412	Abatement of tall weeds
3.	05/24/2024	\$460 /\$412	Abatement of unsecure openings
4.	02/08/2024	\$206.39/\$412	Abatement of tall weeds
5.	04/19/2024	\$243.41/\$412	Abatement of tall weeds
6.	05/23/2024	\$245.19/\$412	Abatement of tall weeds

Total: \$4147.18



938 MENDOZA ST. – RESIDENTIAL & ACCESSORY STRUCTURE

CCPD calls to property:

Nature of Call	938 Mendoza St.
Unknown Nature Non Inury	1
Destruction or Criminal Mischief In Progress	1
Fireworks Possession or Use In Progress Contact Requested	1
Law Enforcement Investigation Field Event	7
Broadcast Info Law Enforcement Only	1
Disturbance in Progress	10
Disturbance injuries Involved	1
Disturbance weapons Involved	2
Shots Fired/Deadly Conduct Shots Heard in Area	1
Suspicious or Unusual Suspicous Person or Persons	1
Theft of Property or Services Just Occurred	1
Disturbance not Progress	11
Law Enforcement Investigation Explain Type	1
Property or Item Found Explain Type	1
Assault in Progress	1
Assault weapons Involved	1
Burglary in Progress	1
LE Assist Assist with Child Custody	6
Traffic or Public Hazard Reckless or Speeding Driver	1
Back Up Routine For EMS Unit	1
Quality of Life Code Enforcement Assist	1
	53

Attempted contact with Property Owner(s): Property owner is deceased.

10/28/2024			
Code Compliance Su	ipervisor: Roland Mal	donado	
Case# V229763-041	524		
Property Owner: Est	ate of Maria H. Cantı	u c/o Maria C. Chavez IND EXEC	
Address (⊠Residen	tial Commercial):	938 Mendoza St.	
Staff Recommendat	ion(s): Demolition		
☐ Residential Struct	cure only	⊠Residential and Accessory Structure	
□Commercial Struc	cture only	☐ Commercial and Accessory Structure	
due to substandard)(1)(c) of the Corpus Christi Property Mair lition of the structure(s), a hazard to the h red.	
		nolish the structure(s) within thirty (30) do hen the City be authorized to demolish.	ays. If demolition is
<u>Notices</u>			
 Final notice Certified let 	ubstandard condition sent by certified mai ter of hearing sent by earing published in ne	y certified mail	
Additional			
 Structure E Taxes due: Utilities: □ 	ntered by: ⊠Search \ □ Current ⊠F	If deceased verification by: ⊠Obituary Warrant □Consent Given by: Past due -Amount owed: \$26,367.36 hactive-Last active date: 4/13/2023	□Death Certificate ⊠Unsecure
6. Lawsuits: ∑			

 \square No

7. Code Enforcement Maintaining Property: ⊠Yes

COMPLAINT

Monday October 28, 2024

Building Standards Board City of Corpus Christi 2406 Leopard St. Corpus Christi, Texas 78408

RE: 938 Mendoza St.

Case # V229763-041524

OWNER: Est. of Maria H. Cantu

Code Compliance Supervisor Roland Maldonado

Dear Board Members:

Pursuant to Article II and in accordance with Section 13-22(B), of the Corpus Christi Property Maintenance Code, this Department has initiated and prepared the above listed case for your review and consideration. On May 22, 2024, the code official determined that there were reasonable grounds to believe there was a violation(s) of the Corpus Christi Property Maintenance Code or any rule or regulation concerning the health, safety, or general welfare adopted by the city as it relates to structures or premises and gave notice of such alleged violation to the owner of the property. Thirty days have elapsed since the notice of violation(s) was provided and such violation(s) have not been cured.

Staff recommends a hearing be set for not less than ten (10) days or more than forty-five (45) days from the date of this complaint. At this hearing staff recommendation for the above listed property will be repair/demolition.

If you have any questions concerning the above, please call (361) 826-3046.

Roland Maldonado

Supervisor

Development Services Code Compliance Division

cc: Carlos Martinez, Monica Pareso, Catherine Giffin, John Solberg, Merced Pena, William Ewing, Chic Henderson

CASE TIMELINE FOR 938 MENDOZA ST.				
Activity	Date	Legal Requirement	Legal Reference	
Code Enforcement Notified of	4/11/2024			
Potential Violation	4/11/2024	n/a	n/a	
Initial Inspection Completed		When building, structure or premise	Corpus Christi Property	
	4/11/2024	thought to be substandard	Maintenance Code 104.2	
Notice of Violation Mailed to Last		When there are reasonable grounds to	City Ordinance	
Known Addresses	5/30/2024	believe there is a violation	Sec. 13-22(A) & (D)(2)	
Notice of Violation Posted in		When owner is unknown, whereabouts	City Ordinance Sec.13-	
Newspaper	7/19/2024 &	unknown, or where service of notice has	22(A) & (D)(3)	
	7/22/2024	failed (Published twice w/in a 10 day period)		
Deadline to comply with Newspaper		When 30 days have elapsed from the date	City Ordinance	
Notice of Violation	8/19/2024	of first publication	Sec. 13-22(B)	
Notice Received		Returned mail rec'd 6/11/24-Return to	n/a	
	6/11/2024	sender, refused, unable to forward		
Returned Notice of Violation Posted at	9/23/24 -9/27/24 &	When notice is returned showing	City Ordinance	
Front Door of Property	9/30/24-10/4/24	unclaimed or not delivered	Sec. 13-22(A) & (D)(4)	
Deadline to comply with Mailed Notice	6/30/2024	30 days from receipt of the notice	City Ordinance	
of Violation	6/30/2024		Sec. 13-22(A)(5)	
Re-inspection		Not less thans 30 days from receipt of the	City Ordinance	
	7/22/2024	notice or when 30 days have elapsed from date of first publication	Sec. 13-22(B)	
Complaint filed with BSB		When owner refused to comply; when	City Ordinance	
		not cured within 30 days from receipt of	Sec. 13-22(B)(2)	
	10/28/2024	notice or any further agreed time; or		
		when 30 days have elapsed from date of first publication		
Notice of Hearing Mailed to Last		At least 10 days prior to hearing	City Ordinance	
Known Address	10/29/2024		Sec. 13-22(C) & (D)(2)	
	10,23,2021			
Notice of Hearing Posted in Newspaper		At least 10 days prior to hearing when	City Ordinance Sec.13-	
	10/28/2024 &	owner is unknown, whereabouts	22(C) & (D)(3)	
	10/29/2024	unknown, or where service of notice has		
		failed (Published twice w/in a 10 day period)		
Notice of Hearing Filed with County		At least 10 days prior to hearing	City Ordinance Sec. 13-	
Clerk	10/30/2024		22(C) & Tx Local Gov't	
	44 /44 /04 44 /47 /05 0		Code 214.001€	
Returned Notice of Hearing Posted at	11/11/24-11/15/24 &	When notice is returned showing unclaimed or not delivered	City Ordinance	
Front Door of Property BSB Agenda Posted	11/18/24-11/20/24	72 hours (3 days) before scheduled time	Sec. 13-22(C) & (D)(4) Texas Govt. Code	
	11/15/2024	of hearing	551.043(a)	
BSB Hearing		Not less than 10 days nor more than 45	City Ordinance	
	11/21/2024	1		



938 MENDOZA ST

Aerial View






































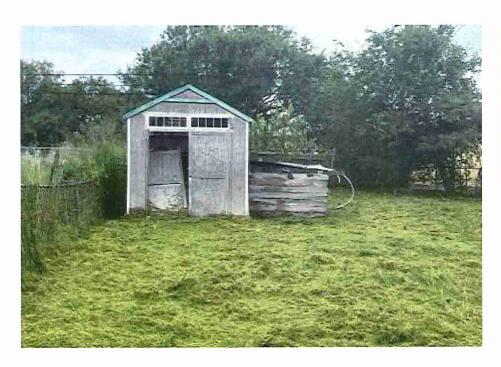











City of Corpus Christi – BUILDING SURVEY

	unt Number: 4100-0	000E 0044			
nspe	ant Namber. 4100-c	0005-0211			
	ection Date: 4/11/20	24			
Zonin	ng Use: RS-6				
Revis	sed Date: 05/24/202	4			
Office	er: Diana T. Garza				
⊃rop∈	erty Address: 938 M	IENDOZA ST			
_egal	I Description: LAGU	INA ACRES LT 21B B	3K 5		
Owne	er: CANTU MARIA I	H ESTATE OF			
Vlail t	to: C/O MARIA C CI	HAVEZ IND EXEC 63	15 VICTORIA		
City,	State, Zip: HOUST	ON, TX 77020			
X X X Placa	Dwelling Wood Frame Vacant ard Posted on: <u>5/22/2</u>	Commercial Masonry Occupied	XAccessory Fire Damage XOpen	Sq. Ft. # of Units XPlacard	1Story XInside Inspection
			Ith and Zoning.		
Perm	nits Required: Building	Plumbing	Electrical	Mechanic	cal
Perm	-	Plumbing Health		Mechanic	cal
	Building Fire ke Alarms:	Health	Electrical Other:		
	Building Fire		Electrical		cal Additional Alarms Required
	BuildingFire ke Alarms:Missing OUTSIDE WALL (304.1, 304.2 304 Type:	HealthInoperative	ElectricalOther:Improperly Loc ROOF: (304.1 & 304.7) Type:	catedA	Additional Alarms Required FOUNDATION: 304.1, 304.4 & 304.5) Type:
Smol	BuildingFire ke Alarms:Missing OUTSIDE WALL (304.1, 304.2 304 Type:Charred Wood	HealthInoperative	ElectricalOther:Improperly Loc ROOF: (304.1 & 304.7) Type:Charred Wood	catedA	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support
Smok	BuildingFire ke Alarms:Missing OUTSIDE WALL (304.1, 304.2 304 Type:	Health Inoperative : 1.4 & 304.6)	ElectricalOther:Improperly Loc ROOF: (304.1 & 304.7) Type:	cated/	Additional Alarms Required FOUNDATION: 304.1, 304.4 & 304.5) Type:
Smol	BuildingFire ke Alarms:Missing OUTSIDE WALL (304.1, 304.2 304 Type:Charred WoodRotten Wood	Health Inoperative : 1.4 & 304.6)	ElectricalOther:Improperly Loc ROOF: (304.1 & 304.7) Type:Charred WoodRotten Eaves	cated/	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood
Smok	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304 Type: Charred Wood Rotten Wood Rotten Corner Bo	Health Inoperative 1.4 & 304.6)	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type:Charred WoodRotten EavesRotten EavesRotten DeckingMissing Shingles	catedA	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304 Type: Charred Wood Rotten Wood Rotten Corner Bo	HealthInoperative : 1.4 & 304.6) pards Paint	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type:Charred WoodRotten EavesRotten Rafter TailsRotten DeckingMissing ShinglesDeteriorated Shingles	cated	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304 Type: Charred Wood Rotten Wood Rotten Corner Bo Missing Boards Badly in Need of Siding Broken / M Holes	HealthInoperative : 1.4 & 304.6) pards Paint	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type:Charred WoodRotten EavesRotten EavesRotten Rafter TailsRotten DeckingMissing ShinglesDeteriorated ShinglesLeaks	cated/	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304) Type: Charred Wood Rotten Wood Rotten Wood Missing Boards Badly in Need of Siding Broken / M Holes Cracks	HealthInoperative : 1.4 & 304.6) pards Paint	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags	cated	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304 Type: Charred Wood Rotten Wood Rotten Corner Bo Missing Boards Badly in Need of Siding Broken / M Holes Cracks Buckled	HealthInoperative : 1.4 & 304.6) pards Paint	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Eaves Rotten Pafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled	catedA	Additional Alarms Required FOUNDATION: 304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304) Type: Charred Wood Rotten Wood Rotten Corner Bo Missing Boards Badly in Need of Siding Broken / M Holes Cracks Buckled Leans	Health Inoperative Inoperative A.4 & 304.6) Dards Paint Alissing X	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type:Charred WoodRotten EavesRotten EavesRotten DeckingMissing ShinglesDeteriorated ShinglesLeaksSagsBuckledCollapsed	cated/	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304) Type: Charred Wood Rotten Wood Rotten Corner Bo Missing Boards Badly in Need of Siding Broken / M Holes Cracks Buckled Leans Missing Brick	HealthInoperative : 1.4 & 304.6) pards Paint	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled Collapsed Worn	cated	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills Rotten Sills
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304 Type: Charred Wood Rotten Wood Rotten Corner Bo Missing Boards Badly in Need of Siding Broken / N Holes Cracks Buckled Leans Missing Brick Loose Brick	HealthInoperative : 4.4 & 304.6) pards Paint //issing X X	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type:Charred WoodRotten EavesRotten EavesRotten DeckingMissing ShinglesDeteriorated ShinglesLeaksSagsBuckledCollapsedWornTorn	cated/	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills Rotten Sills Damaged Floor Joist
Smol	Building Fire ke Alarms: Missing OUTSIDE WALL (304.1, 304.2 304) Type: Charred Wood Rotten Wood Rotten Corner Bo Missing Boards Badly in Need of Siding Broken / M Holes Cracks Buckled Leans Missing Brick	HealthInoperative : 4.4 & 304.6) pards Paint //issing X X	ElectricalOther: Improperly Loc ROOF: (304.1 & 304.7) Type: Charred Wood Rotten Eaves Rotten Rafter Tails Rotten Decking Missing Shingles Deteriorated Shingles Leaks Sags Buckled Collapsed Worn	cated	Additional Alarms Required FOUNDATION: (304.1, 304.4 & 304.5) Type: nadequate Support Rotten Wood Piers Lean Piers Missing Cracks/Perimeter Wall Cracks/Slab Pads Missing/Cracked Missing Skirting Missing Access Cover Exposed Sills Rotten Sills

	WINDOWS: (304.1, 304.2 304.13,	PORCHES	: (304.1, 304.2, 304	1.10,	DOORS: (304.1, 304.2, 304.13,
	304.13.1, 304.13.2, 304.14 &	304.12, 30	5.4, 305.5 & 307.1)		304.14, 304.15, 304.16, 304.18
	304.17)				305.6 & 702.1)
	Charred Wood	Charred W	ood	L	_Charred Wood
Χ	Broken Glass	Missing / B	roken Boards		_Missing
Χ	Missing Screens	Loose		X	_Damaged
	Torn Screens X	Rotten Wo	od	***	_Poor Fit
	Missing / Broken Sash X	Inadequate	Support		_Damaged / Missing Screen(s)
	Do Not Open	Support Po	_		_Off Hinges
<u>X</u>	Rotten Sills	Support Po	st Loose		_Blocked Exit
<u>X</u>	Rotten / Broken Frames	Faulty We	ather Protection	Χ	_Rotten
	Other:	Other:		B1145	_Other:
	STEPS: (304.1, 304.2		PLUMBING:	BATHTUB	/ SHOWER
	304.10, 304.12, 305.4 & 305.5)		(403.2, 502.1	1, 502.2, 502	2.3, 504.1, 504.2, 504.3, 505.1.1
			& 505.3)		
	Charred Wood		Missing		
	Rotten Wood	_	Faucets Loos	se / Broken	/ Missing
	Missing Boards		No Anti-Siph	on Faucets	
<u>X</u>	Inadequate Support	_	Missing Over	rflow Plate	
	Missing Handrails		Missing Tap		
	Faulty Weather Protection	_	Missing Shov	wer Head	
	Other:		Not Vented		
		X _.	Disconnected	d	
		_	Stopped Up	.	
			Damaged Sh	nower Stall	
		_	Other:		
	PLUMBING: WATER CLOSET		WATER HEA		
	(404.4.3, 502.1, 502.2, 502.3, 502.4	1, 503.1, 503.4,	(505.4, 603.1	1, 603.2, 60	3.3, 603.4 603.5 & 603.6)
	504.1, 504.2, 504.3, 505.1.1, 506.1	& 506.2)			
	Missing	_	Gas		
	No Anti-Siphon Ballcock	_	Electric		
	Stopped Up	_	Missing		
	Poorly Anchored	Х			n I NA I NAC A San
	Seeps Around Bowl				Release Valve Missing
-	Water Supply Line Leaks	_			Release Valve Broken
	Flush Ell Leaks		Drain Line M	•	
	Runs Constantly	_	Not Approve		
	Tank Broken / Cracked	-	Not Extende Elbowed Do		
	Bowl Broken / Cracked	-			
<u>X</u>	Disconnected	_	Vent Missing No Double V	-	ttic
-	Missing Flush Handle	_	Nonconform	•	ttio
	Missing Flapper	****	Inadequate (-	Air
***	Urinal; No Back-Flow Preventive No Elongated Bowl / Open-end Sea	 of	Thermostat		
****	Other:	_	No Gas Cut	_	
	Oulet.		No das dut Missing Fire		
		_	Masing rile		proved Pipe
		_	Gas Fired –		
			Gas Fired –		
		_	Fire Damage		
		_	Other:		

	LAVATORY: (404.4.3, 502.1, 502.2, 502.3 502.4, 504.1, 504.2, 504.3, 505.1.1,	GAS SYSTEM: (602.1, 602.2, 602.3, 602.5 603.1, 603.2, 603.3, 603.4, 603.5 & 603.6)
	506.1 & 506.2)	
	Missing	Gas Pressure Test Required
	No Anti-Siphon Faucets	Gas Leak
	Faucets Leak / Broken / Missing	Line Appears to Enter Building Below Grade Level
	"P" Trap Leaks / Missing	Gas Supply Not Approved Pipe
	Defective Trap	Rubber Hose to Space Heaters
	Stopped Up	Non-Rigid Pipe Run Through Partition Wall
	Water Supply Line Leak	Other:
	Loose from Wall	
	Nonconforming Waste Line	
<u>X</u>	Disconnected	
	Other:	
	KITCHEN SINK: (305.1, 305.3, 502.1,	PLUMBING MISCELLANEOUS:
	505.1.1, 506.1 & 506.2)	(504.1, 504.2, 504.3, 505.3, 506.2 & 507.1)
	Defective Trap	Open Clean Out / Water Leak; Yard / Under House
	Faucets Loose / Broken	Vent Stack Missing / Broken
	Faucets Missing	Vent Stack Not Extended Through Roof
	"P" Trap Rubber Hose	Rain Guard Damaged / Missing
	Trap Leaks / Missing	Exposed Exterior PVC Pipe
	Stopped Up	PVC Water Supply Lines
<u>X</u>	Disconnected	Washer No "P" Trap / Not Vented / Not Cut Offs
	Damaged Counter Top	Sewer Line Stopped Up
	Damaged Back Splash	Sewer Running Out on Ground
	Other:	Other:
	ELECTRICAL SERVICE: (604.1, 604.2	INSIDE WALLS AND CEILINGS:
	604.3, 604.3.1, 604.3.1.1, 604.3.2, 604.3.2.1	(305.1, 305.2, 305.3 & 404.3)
	605.1, 605.2 & 605.3)	
	Service Panel Burned	Charred Wood
	Service Missing	Paint Deteriorated
	Service Appears Below Code	Cracks
	Two-Wire Service	Holes
	Inadequate	Torn Wallpaper
	Defective	Damaged Paneling
<u>X</u>	Disconnected	XSheetrock Broken / Missing / Holes, 506.1 & 506.2
	Service Not Grounded	XSheetrock Mildewed / Buckled
	Missing Breakers / Fuses	XCeiling Damaged / Missing
	Missing Interior / Exterior Panel Cover	Water Damaged / Smoke Damaged
	Exposed Wiring	Impervious Material Around Tub
	Nonconforming Wiring in Panel	Enclosure Damaged / Missing
	Drops Too Low	Walls Around Tub Not Water Resistant
	Other:	Inadequate Ceiling Height
		Other:

	SYSTEM:	INTERIOR FLOORS:	
	(604.3.2. 604.3.2.1, 605.1, 605.2 & 605.3)	(305.1, 305.2, 305.3 & 305.4)	
	Burned Wiring / Plugs / Switches	Charred Wood	
	Burned Fixtures	Rotten Wood	
	Less Than 1 Duplex Recept. /20 liner ft-	XMissing Boards	
	Bedroom/Living Rm/Dining Rm/Den/Kitchen	Holes	
	No Small Appliance Circuits Over Kitchen	Cracks	
	Counter Space with GFCI	Not Level	
	Only One Small Appliance Circuit Over Kitchen	Buckled	
		Torn	
	Counter Space with NO GFCI		
	Kitchen Appliance Circuits – No GFCI	XDamaged	
<u>X</u>	Plugs Missing / Loose / Broken	Other:	
<u>X</u>	Switches Missing / Loose / Broken		
<u>X</u>	Fixtures Missing / Loose / Broken		
<u>X</u>	Missing Switch Cover / Plug Covers		
	Extension Cords in Place of Permanent Wiring		
	Bathroom Circuit NO GFCI		
	Conduit Broken / Loose / Missing		
	No Separate Circuit For		
	No Disconnect for Air Conditioner		
	Exterior Lights Missing; Front / Back / Side		
	Porch Lights Broken / Missing / Loose		
	Other:		
	RATIOLIA NUO ALI.	ACCESSORY SURVEY	
	MECHANICAL:	ACCESSORY SURVEY:	: 2)
	(403.1, 403.2, 603.1 & 603.6)	(302.7, 304.1, 304.2, 304.4, 304.5, 304.6 & 305	1.2)
	Vented Wall Heater Damaged / Missing	TYPE:	
	Floor Furnace Damaged / Missing	Roof Type:	
	Nonconforming Gas Line to Space Heater	XRotten	
	Wall Heater with No Vent in Bathroom	Loose	
	Thermostat Damaged / Missing	Torn	
	Gas-Fired Heating Appliance within 2' of	Holes	
	Tub / Shower / Water Closet	Missing	
	Condensing Unit Damaged / Missing		
	No Vent Fan or Window in Bathroom	Walls Type:	
	Vent Fan Missing / Not Operable	XRotten	
	Heat with No Vent in Commercial Building	Leaning	
	Fire Damage	Buckled	
	Other:	Missing	
		Other:	
	UNSANITARY CONDITIONS:		
	(308.3, 309.1, 504.1 & 505.1.2)	Foundation Type:	
	No Hot and Cold Water Supply	Sunken	
	Insect, Roach, Rodent Infestation	Rotten Sills	
	Lacks Adequate Garbage Containers	Other:	
-	Other:		



_Cracked _Rotten _Other:

CODE ENFORCEMENT DIVISION

ACCESSORY BUILDING SURVEY



Address: Legal Description: Tax Account No: Property Owner: Mailing Address: City, State, Zip:	938 MENDOZA LAGUNA ACRES 4100-0005-021 CANTU MARIA C/O MARIA C C HOUSTON, TX 7	S LT 21B BK 5 1 H ESTATE OF HAVEZ IND EXEC	C 6315 VI	CTORIA						
Inspection Date: Zoning District: Compliance Officer: Placard Date: Case No: Corrections must be management	4/11/2024 Grace Elledge 5/22/2024 V229763-04152		u to comp	alv with	the Cornus Chr	icti Dron	oorty M	aintan	ance Co	nda
and/or ordinances of the Electrical, Mechanical,	ne City of Corpus	Christi. The fol								oue
Permits required:	Building	Plumbing	Electrica	al	Mechanical	Fire	Othe	r:		
Accessory Structure Ty (302.7, 304.1, 304.2, 304.4		.7, 305.1 & 305.2)	Wood F	rame	Masonry	Fire Da	amage			
Roof Type: X Rotten Loose Torn										
HolesMissing				Descri	ption	Max	Unit A	Unit B	Unit C	Unit D
Other:				Roofir	ng Frame	16				
Wall Type:				Roof C	Cover	17				
XRotten Leaning			,	Wall F	raming	18				
Buckled			•	Siding		15				
Missing Other:				Found	lation	24				
Foundation Type:				Doors	/Windows	10				
Sunken				Total	%	100				

VIOLATION(S): 938 MENDOZA ST.

- 108.1.3 Structure unfit for human occupancy. A structure is unfit for human occupancy whenever the code official finds that such structure is unsafe, unlawful or, because of the degree to which the structure is in disrepair or lacks maintenance, is insanitary, vermin or rat infested, contains filth and contamination, or lacks ventilation, illumination, sanitary or heating facilities or other essential equipment required by this code, or because the location of the structure constitutes a hazard to the occupants of the structure or to the public.
- 302.7 Accessory structures. All accessory structures, including detached garages, shall be maintained structurally sound and in good repair.
- 304.1 General. The exterior of a structure shall be maintained in good repair, structurally sound and anitary so as not to pose a threat to the public health, safety or welfare.
- 304.12 Handrails and guards. Every handrail and guard shall be firmly fastened and capable of supporting normally imposed loads and shall be maintained in good condition.
- 304.13 Window, skylight and door frames. Every window, skylight, door and frame shall be kept in sound condition, good repair and weather tight.
- 304.15 Doors. Exterior doors, door assemblies, operator systems if provided, and hardware shall be maintained in good condition. Locks at all entrances to dwelling units and sleeping units shall tightly secure the door. Locks on means of egress doors shall be in accordance with Section 702.3.
- 304.6 Exterior walls. Exterior walls shall be free from holes, breaks, and loose or rotting materials; and maintained weatherproof and properly surface coated where required to prevent deterioration.
- 304.7 Roofs and drainage. The roof and flashing shall be sound, tight and not have defects that admit rain. Roof drainage shall be adequate to prevent dampness or deterioration in the walls or interior portion of the structure. Roof drains, gutters and downspouts shall be maintained in good repair and free from obstructions. Roof water shall not be discharged in a manner that creates a public nuisance.
- 305.6 Interior doors. Every interior door shall fit reasonably well within its frame and shall be capable of being opened and closed by being properly and securely attached to jambs, headers or tracks as intended by the manufacturer of the attachment hardware.
- 504.1 General. Plumbing fixtures shall be properly installed and maintained in working order, and shall be kept free from obstructions, leaks and defects and be capable of performing the function for which such plumbing fixtures are designed. Plumbing fixtures shall be maintained in a safe, sanitary and functional condition.
- 505.1 General. Every sink, lavatory, bathtub or shower, drinking fountain, toilet or other plumbing fixture shall be properly connected to either a public water system or to an approved private water system. Kitchen sinks, lavatories, laundry facilities, bathtubs and showers shall be supplied with hot or tempered and cold running water in accordance with the International Plumbing Code as adopted and amended by the City.

Exceptions: Facilities constructed lawfully without hot water.

602.3 Heat supply. Every owner and operator of any building who rents, leases or lets one or more dwelling units or sleeping units on terms, either expressed or implied, to furnish heat to the occupants thereof shall supply heat to maintain a minimum temperature of 68°F (20°C) in all habitable rooms, bathrooms and toilet rooms. Exception: 1. When the outdoor temperature is below the winter outdoor design temperature for the locality, maintenance of the minimum room temperature shall not be required provide that the heating system is operating at its full design capacity. The winter outdoor design temperature for the locality shall be as indicated in Appendix D of the International Plumbing Code as

adopted and amended by the City.

2. In areas where the average monthly temperature is above 30°F (-1°C), a minimum temperature of 65°F (18°C) shall be maintained.

604.2 Service. The size and usage of appliances and equipment shall serve as a basis for determining the need for additional facilities in accordance with NFPA 70. Dwelling units shall be served by a three-wire, 120/240 volt, single-phase electrical service having a minimum rating of 60 amperes. Exception: Electric service may be maintained if installed lawfully.

605.1 Installation. Electrical equipment, wiring and appliances shall be properly installed and maintained in a safe and approved manner.

605.2 Receptacles. Every habitable space in a dwelling shall contain not less than two separate and remote receptacle outlets. Every laundry area shall contain not less than one grounding-type receptacle or a receptacle with a ground fault circuit interrupter. Every bathroom shall contain not less than one receptacle. Any new bathroom receptacle outlet shall have ground fault circuit interrupter protection. All receptacle outlets shall have the appropriate faceplate cover for the location.



CASE DOCUMENTATION FOR VIOLATION LETTERS MAILED FOR BSB HEARING [ALL LETTERS ARE MAILED CERTIFIED AND FIRST CLASS]

Case No: B1 Letters, V229763-041524

ADDRESS: 938 MENDOZA ST.
Tax Account No: 4100-0005-0211

Owner(s): CANTU MARIA H. ESTATE OF C/O MARIA C. CHAVEZ IND EXEC.

LAST UPDATED ON: Wednesday, November 06, 2024

LETTERS MAILED from 5/30/2024-5/30/2024

MAILED TO	ASSOCIATION WITH PROPERTY	RETURNED MAIL NOTES
CANTU MARIA H ESTATE OF	DECEASED OWNER	B1 Letter Mailed on 5/30/2024
C/O MARIA C CHAVEZ IND EXEC		
6315 VICTORIA		
HOUSTON, TX 77020		
CANTU MARIA H ESTATE OF C/O MARIA C CHAVEZ	DECEASED OWNER	B1 Letter Mailed on 5/30/2024
IND EXE		RETURNED MAIL REC'D 6/11/24-
938 MENDOZA ST		RETURN TO SENDER
CORPUS CHRISTI, TX 78416		REFUSED
		UNABLE TO FORWARD
UNKNOWN HEIRS OF MARIA H. CANTU	UNKNOWN HEIRS OF DECEASED OWNER	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		
HOUSTON, TX 77020		
UNKNOWN HEIRS OF MARIA H CANTU	UNKNOWN HEIRS OF DECEASED OWNER	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
		REFUSED
		UNABLE TO FORWARD
JOSE HERRERA	HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		
HOUSTON, TX 77020		
JOSE HERRERA	HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
		REFUSED
		UNABLE TO FORWARD
NAOMI CANTU HERNANDEZ	HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		

HOUSTON, TX 77020		
NAOMI CANTU HERNANDEZ	HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
·		REFUSED
		UNABLE TO FORWARD
OLGA CANTU ROY	HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		
HOUSTON, TX 77020		
OLGA CANTU ROY	HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST	111 721	RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
CON 03 CHN311, 1X 70410		REFUSED
		UNABLE TO FORWARD
OLGA CANTU ROY	HEIR	B1 Letter Mailed on 5/30/2024
	HEIR	RETURNED MAIL RECD' 6/27/24-
12300 FLEMING DR APT 175		RETURN TO SENDER
HOUSTON, TX 77013		
		UNCLAIMED
		UNABLE TO FORWARD
JOSE LUIS CANTU JR	HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		
HOUSTON, TX 77020		
JOSE LUIS CANTU JR	HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
	•	REFUSED
		UNABLE TO FORWARD
JOSE LUIS CANTU JR	HEIR	B1 Letter Mailed on 5/30/2024
254 CAPE COD		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78412		RETURN TO SENDER
, , , , , , , , , , , , , , , , , , , ,		ATTEMPTED- NOT KNOWN
		UNALBE TO FORWARD
JUAN C. CANTU	DECEASED HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		• • •
HOUSTON, TX 77020		
JUAN C CANTU	DECEASED HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST	DECEASED HEIR	RETURNED MAIL REC'D 6/11/24-
	+	RETURN TO SENDER
CORPUS CHRISTI, TX 78416		REFUSED
		UNABLE TO FORWARD
LINIVALONANI LIFIDO OF PLANTO CANITA	LINIANOWAL HEIDS OF DESCRASED HEID	B1 Letter Mailed on 5/30/2024
UNKNOWN HEIRS OF JUAN C. CANTU	UNKNOWN HEIRS OF DECEASED HEIR	DI Letter Mailed Oil 3/30/2024

6315 VICTORIA		
HOUSTON, TX 77020		
UNKNOWN HEIRS OF JUAN C CANTU	UNKNOWN HEIRS OF DECEASED HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
		REFUSED
, x		UNABLE TO FORWARD
MARY ESTER CANTU CHAVEZ	HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		
HOUSTON, TX 77020		
MARY ESTER CANTU CHAVEZ	HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA ST		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
		REFUSED
		UNABLE TO FORWARD
ROY CANTU AKA ROGELIO CANTU	HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA		
HOUSTON, TX 77020		
ROY CANTU AKA ROGELIO CANTU	HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA SR		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
		REFUSED
		UNABLE TO FORWARD
ROY CANTU AKA ROGELIO CANTU	HEIR	B1 Letter Mailed on 5/30/2024
1118 MENDOZA ST		RETUREND GREEN CARD REC'D 6/6/24-
CORPUS CHRISTI, TX 78416		SIGNED BY CANTU
,		
JESSE F. CANTU AKA JESUS FRANCISCO CANTU	HEIR	B1 Letter Mailed on 5/30/2024
6315 VICTORIA	5033***/43	
HOUSTON, TX 77020		
JESSE F CANTU AKA JESUS FRANCISCO CANTU	HEIR	B1 Letter Mailed on 5/30/2024
938 MENDOZA SR		RETURNED MAIL REC'D 6/11/24-
CORPUS CHRISTI, TX 78416		RETURN TO SENDER
		REFUSED
		UNABLE TO FORWARD
JESSE F CANTU AKA JESUS FRANCISCO CANTU	HEIR	B1 Letter Mailed on 5/30/2024
11203 SAM NAIL RANCH		RETURNED MAIL REC'D 6/24/24-
SAN ANTONIO, TX 78245		RETURN TO SENDER
,		UNCLAIMED
		UNALBE TO FORWARD
ARTURO C. CANTU AKA CLEMENTE ARTURO CANTU	HEIR	B1 Letter Mailed on 5/30/2024

6315 VICTORIA		
HOUSTON, TX 77020		
ARTURO C CANTU AKA CLEMENTE ARTURO CANTU 938 MENDOZA ST CORPUS CHRISTI, TX 78416	HEIR	B1 Letter Mailed on 5/30/2024 RETURNED MAIL REC'D 6/11/24- RETURN TO SENDER REFUSED UNABLE TO FORWARD
ARTURO C. CANTU AKA CLEMENTE ARTURO CANTU 1704 BOSTIC ST. HOUSTON, TX. 77093-7424	HEIR	B1 Letter Mailed on 5/30/2024
MARGIE CANTU CERTUCHE AKA MARGARITA CANTU ZERTUCHE 6315 VICTORIA HOUSTON, TX 77020	HEIR	B1 Letter Mailed on 5/30/2024
MARGIE CANTU CERTUCHE AKA MARGARITA CANTU ZERTUCHE 938 MENDOZA ST CORPUS CHRISTI, TX 78416	HEIR	B1 Letter Mailed on 5/30/2024 RETURNED MAIL REC'D 6/11/24- RETURN TO SENDER REFUSED UNABLE TO FORWARD
MARGIE CANTU CERTUCHE AKA MARGARITA CANTU ZERTUCHE 3615 ITASKA CTS CORPUS CHRISTI, TX 78415	HEIR	B1 Letter Mailed on 5/30/2024
ROSEMARY CANTU SALAZAR AKA ROSE MARY SALAZAR 6315 VICTORIA HOUSTON, TX 77020	HEIR	B1 Letter Mailed on 5/30/2024
ROSEMARY CANTU SALAZAR AKA ROSE MARY SALAZAR 938 MENDOZA ST CORPUS CHRISTI, TX 78416	HEIR	B1 Letter Mailed on 5/30/2024 RETURNED MAIL REC'D 6/11/24- RETURN TO SENDER REFUSED UNABLE TO FORWARD
ROSEMARY CANTU SALAZAR AKA ROSE MARY SALAZAR 6343 CRESTSIDE DR PASADENA, TX 77505	HEIR	B1 Letter Mailed on 5/30/2024 RETURNED GREEN CARD REC'D 6/6/24- SIGNED BY UNREADABLE
MARY CANTU HINOTE AKA MARIA GUADALUPE HINOTE 6315 VICTORIA HOUSTON, TX 77020	HEIR	B1 Letter Mailed on 5/30/2024

MARIA CANTU HINOTE AKA MARIA GUADALUPE HINOTE 938 MENDOZA ST CORPUS CHRISTI, TX 78416	HEIR	B1 Letter Mailed on 5/30/2024 RETURNED MAIL REC'D 6/11/24- RETURN TO SENDER REFUSED
MARIA CANTU HINOTE AKA MARIA GUADALUPE HINOTE 24032 MISTY LAKE CIR NEW CANEY, TX 77357	HEIR	UNABLE TO FORWARD B1 Letter Mailed on 5/30/2024